EUV Inspection of Defect-Repair Sites
& Status of the actinic inspection tool

Kenneth Goldberg, Anton Barty

Phillip Seidel, Patrick Kearney, Rainer Fettig,

Hakseung Han*, Obert Wood*

**current and former project managers*

This work was performed under the auspices of the U. S. Department of Energy by University of California, Lawrence Livermore National Laboratory under Contract W-7405-Eng-48.

KAGoldberg@lbl.gov

Advanced Materials Research Center, AMRC, International SEMATECH Manufacturing Initiative, and ISMI are servicemarks of SEMATECH, Inc. SEMATECH, the SEMATECH logo, Advanced Technology Development Facility, ATDF, and the ATDF logo are registered servicemarks of SEMATECH, Inc. All other servicemarks and trademarks are the property of their respective owners.

Fundamental questions remain for EUV reticles

Isolated Defects

- Can we detect all printable defects?
- Are there "**actinic-only" defects?**
- Can mask-blank defects be **repaired?**

Pattern/Proximity Defects

- Can we use **aerial image data** to improve modeling?

Inspection tools

- **Performance**?
- Does inspection cause **damage?**

Printing

- **Modeling**
- **AFM, SEM**
- **Non-Actinic Inspection**
  λ = 266, 488 nm
- **Actinic (EUV) Inspection**
  scanning & imaging
  bright-field, dark-field

cross-comparison is the path to greater knowledge

KAGoldberg@lbl.gov

Different wavelengths see different ML structures

- **EUV light penetrates deeply** into the resonant ML structure
- **488-nm** and **266-nm** light barely reaches below the surface

Field Penetration for three λs

λ	"1%" depth	bi-layers
13.4 nm	215 nm	31
488 nm	53.6 nm	8
266 nm	20.6 nm	3

At-wavelength testing *probes the actual multilayer response.*

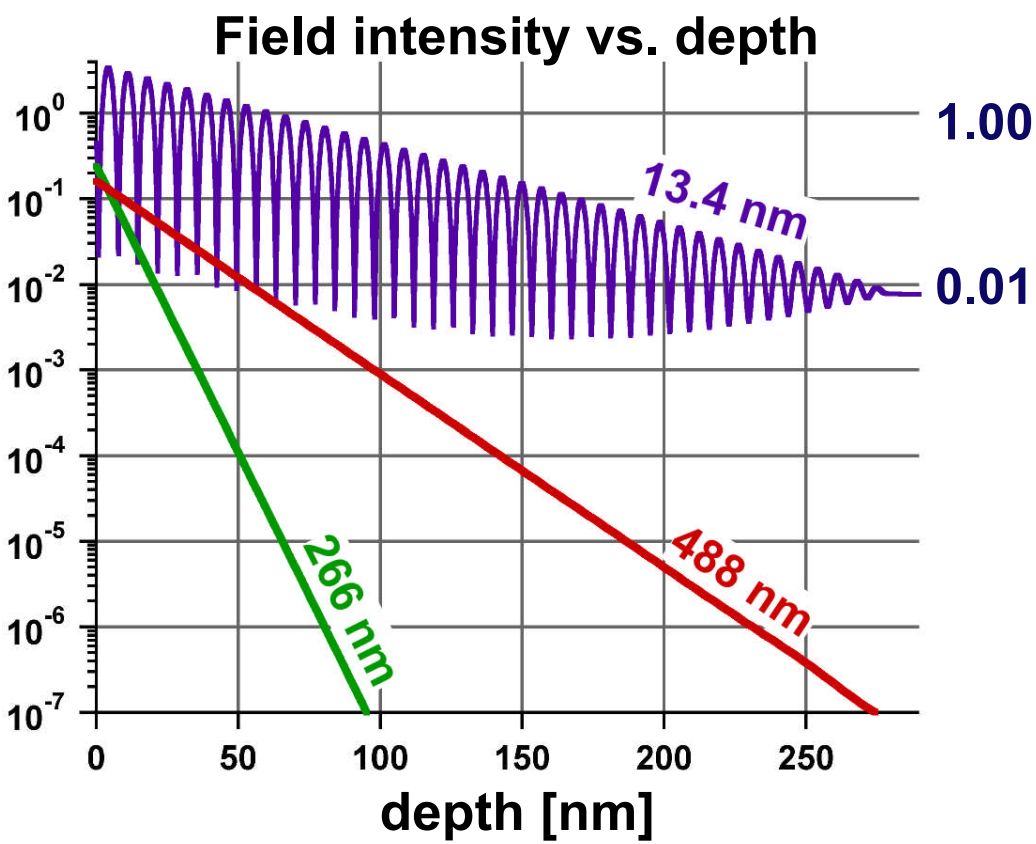

KAGoldberg@lbl.gov

The SEMATECH Berkeley Actinic Mask Inspection Tool

Worldwide, this is the only EUV mask inspection tool offering **imaging** *and* **scanning** in **dark-field** *and* **bright-field** modes.

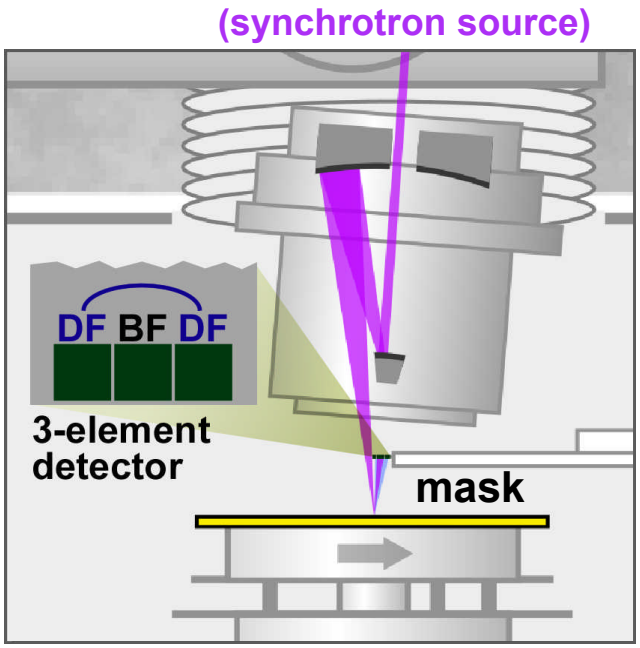

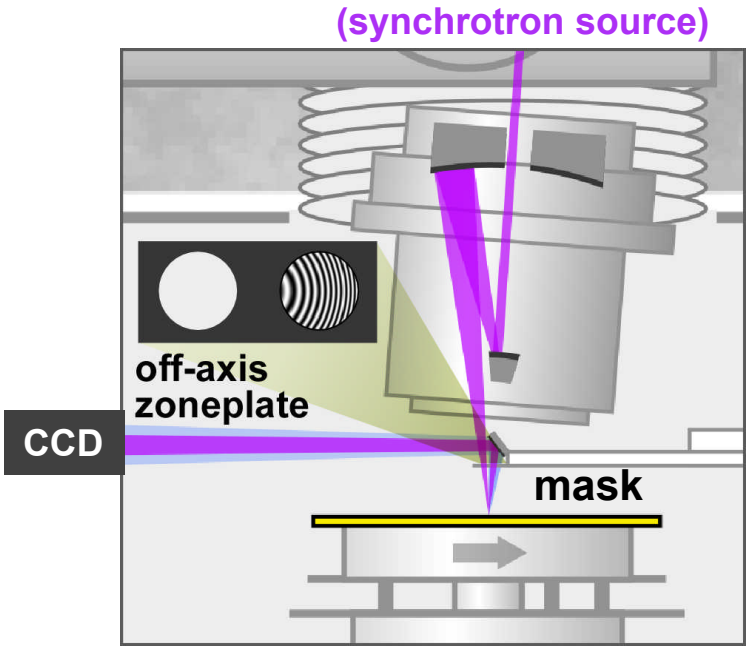

Scanning reveals open-field defects, measures subtle mirror reflectivity changes not seen without EUV light.

Imaging uses a zoneplate lens to measure the aerial image directly, testing defect printability models without printing.

KAGoldberg@lbl.gov

SEMATECH Actinic Mask Inspection tool is fully operational

Scanning & Imaging in routine daily operation

Scanning

Bright-field *Reflectivity testing*

→ ≥1 μm spot

→ *R* measurements to ±0.1%

Dark-field *Scattering*

→ Finds printable defects not seen by non-actinic tools.

Region-of-Interest identification

→ Used to locate regions of interest for imaging.

*We find **actinic-only defects**, in dark-field and bright-field.*

Imaging

Exposure Time

→ **0.3–1.5 s** alignment & navigation

→ **20–35 s** for highest resolution

Resolution

→ **~100 nm**, Mask

~25 nm, 4× Wafer equivalent

Magnification

→ **~700x**, *direct to EUV CCD*

***NA* = 0.0625** (0.25 NA, 4x stepper)

***Higher resolutions** and custom pupil shapes are possible.*

KAGoldberg@lbl.gov

Actinic scanning-mode: *a 1-µm reflectometer*

Our **focused beam** probes **surface reflectivity** and **scattering** *micron-by-micron*.

ALS Beamline 6.3.2 **Reflectometer** (absolute *R*) ≥ 300 x 10 µm

Berkeley Actinic Mask Inspection scanning **Focal Spot** (relative *R*)

5 x 5 µm
3 x 3 µm
1 x 1 µm

In 2006 we studied:

- The **sensitivity** of actinic & non-actinic inspection tools
- The EUV response of open-field **defect-repair sites**
- **Damage** caused by mask inspection

KAGoldberg@lbl.gov

Earlier comparison of 4 inspection tools. . .

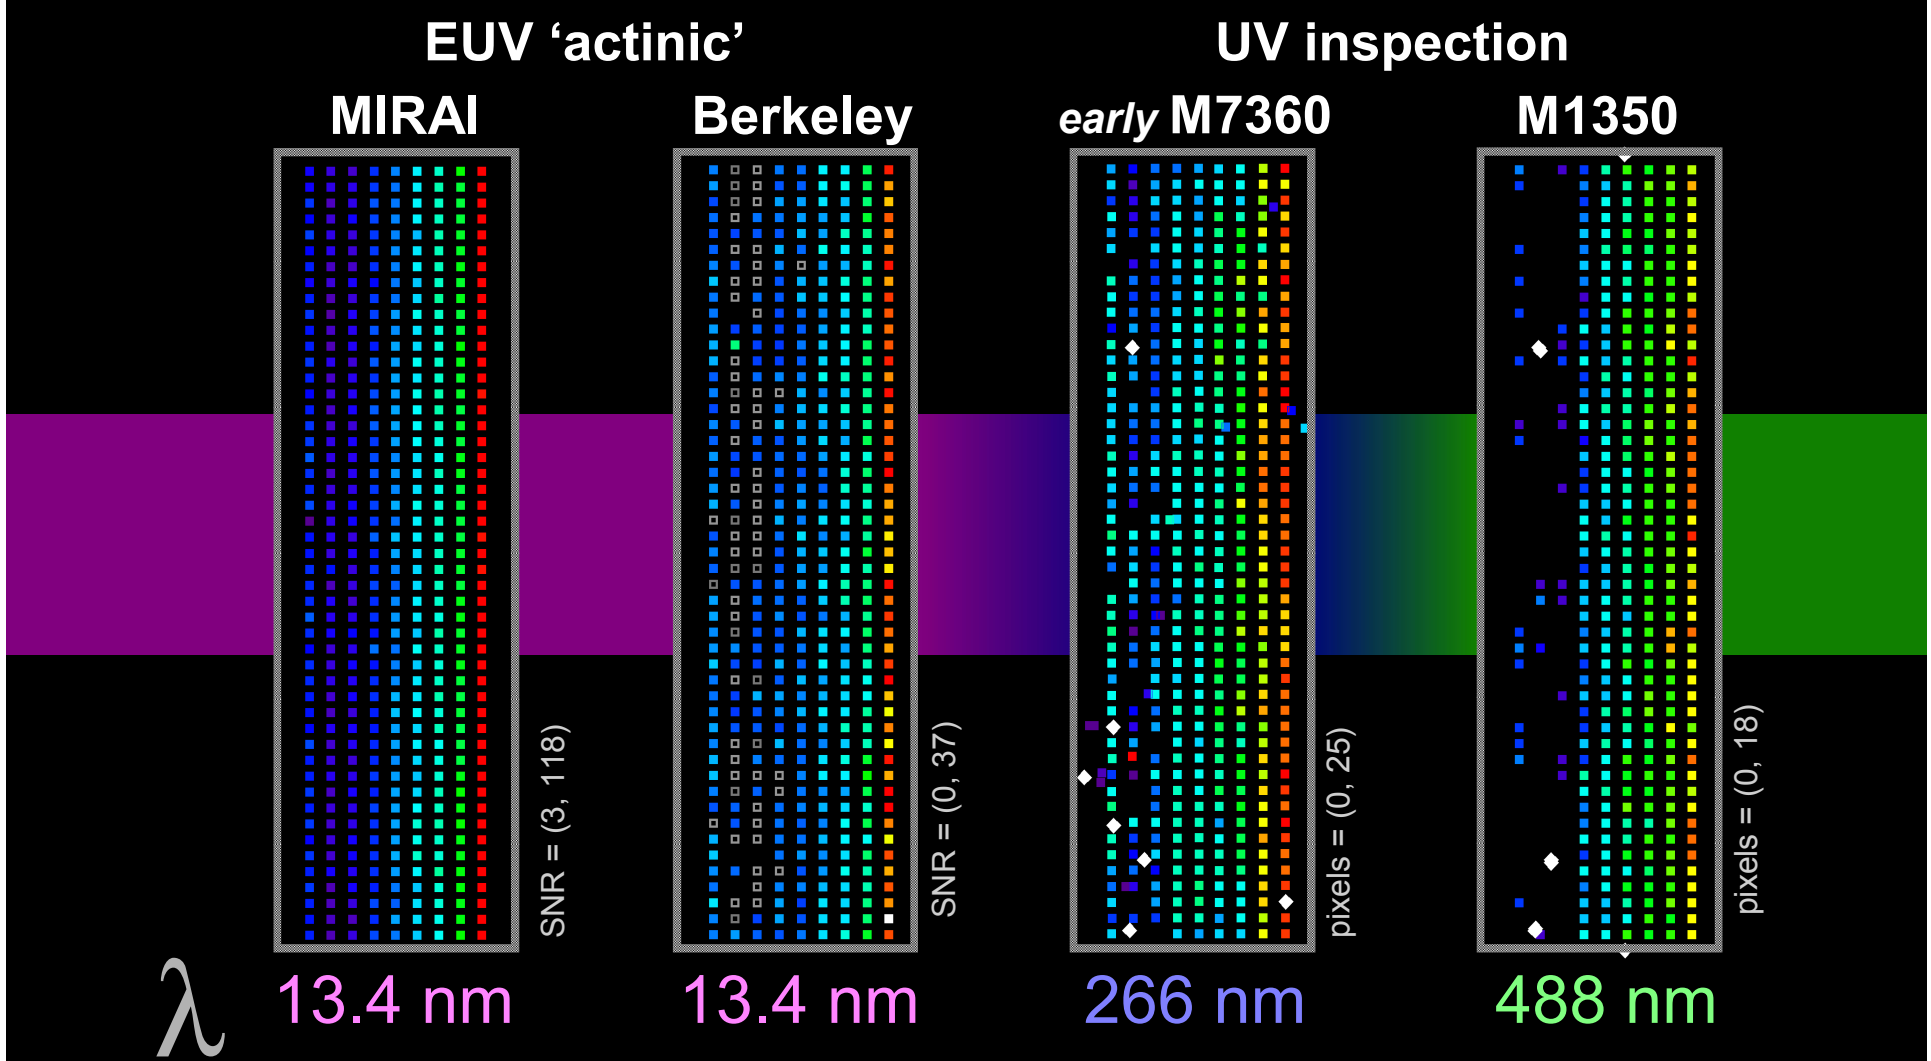

Goldberg, *et al.*, *JVST B 2006*

KAGoldberg@lbl.gov

In collaboration with ***Lasertec,***
Y. Tezuka, T. Terasawa, P. Kearney

Bright-field revealed defects that do not scatter

Phase defects **scatter** well
→ *buried bumps and pits*

Surface particles and contamination **absorb light** and scatter poorly,
→ especially µm-scale defects

Actinic **DF only** could miss critical defects

BF only doesn't have enough sensitivity

EUV
dark-field
scattering

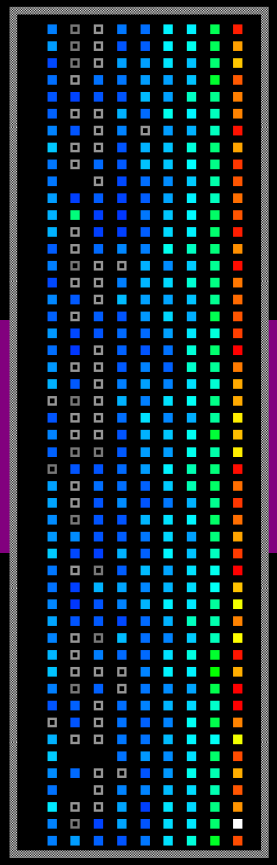

EUV
bright-field
reflectivity

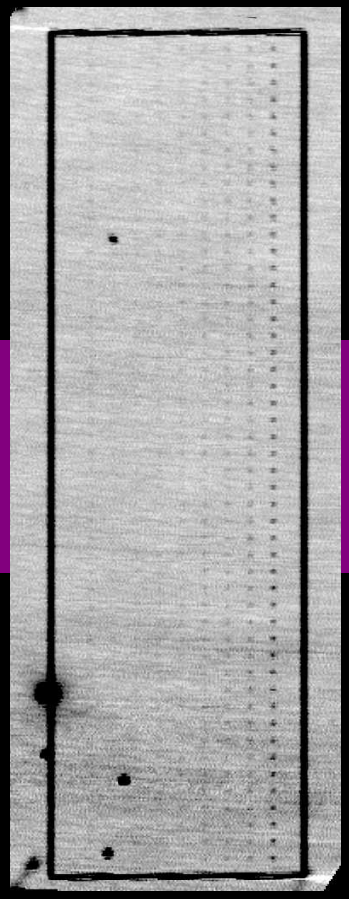

KAGoldberg@lbl.gov

In collaboration with ***Lasertec,***
Y. Tezuka, T. Terasawa, P. Kearney

A multilayer-coated blank with 14 repair sites

Zeiss NaWoTec

Group I
A,B,C,D,E

Sites were etched as ditches (pits) with shallow sidewall angles in the range of 2°–4°.

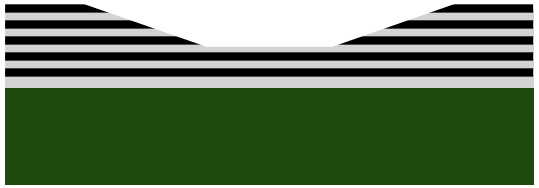

Group II
F,G,H,I,J

SiO_2 was deposited in different thicknesses: 1.5–12 nm

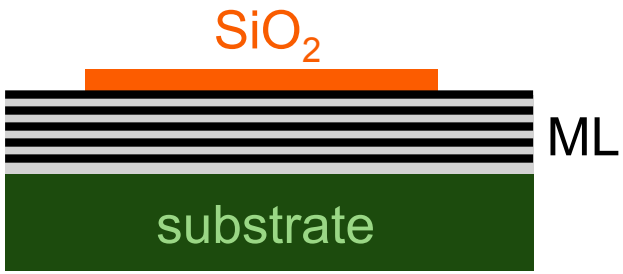

Group III
K,L,M,N

Defects etched into the top layer to different depths. The area was covered with a ~5 nm SiO_2 protection layer

Note: *An ideal repair recipe was not found here, but we learn from the measurements.*

KAGoldberg@lbl.gov

The repair sites were measured in five ways

M1350

λ = 488 nm

Sematech N.

defect review

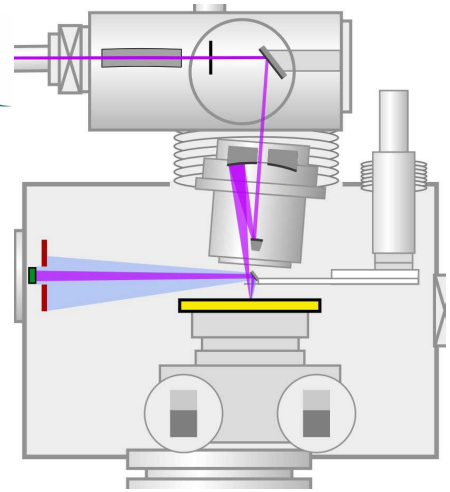

Actinic (EUV)

BF / DF

scanning

Zeiss, NaWoTec

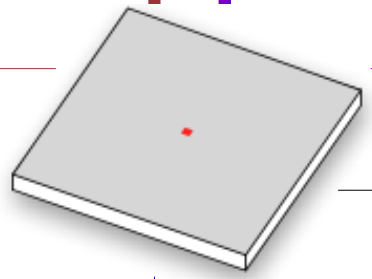

defect-repair mask

QuickTime™ and a
TIFF (Uncompressed) decompressor
are needed to see this picture.

SEM

AFM

QuickTime™ and a
TIFF (Uncompressed) decompressor
are needed to see this picture.

KAGoldberg@lbl.gov

Measurements of Group I: *shallow ditches*

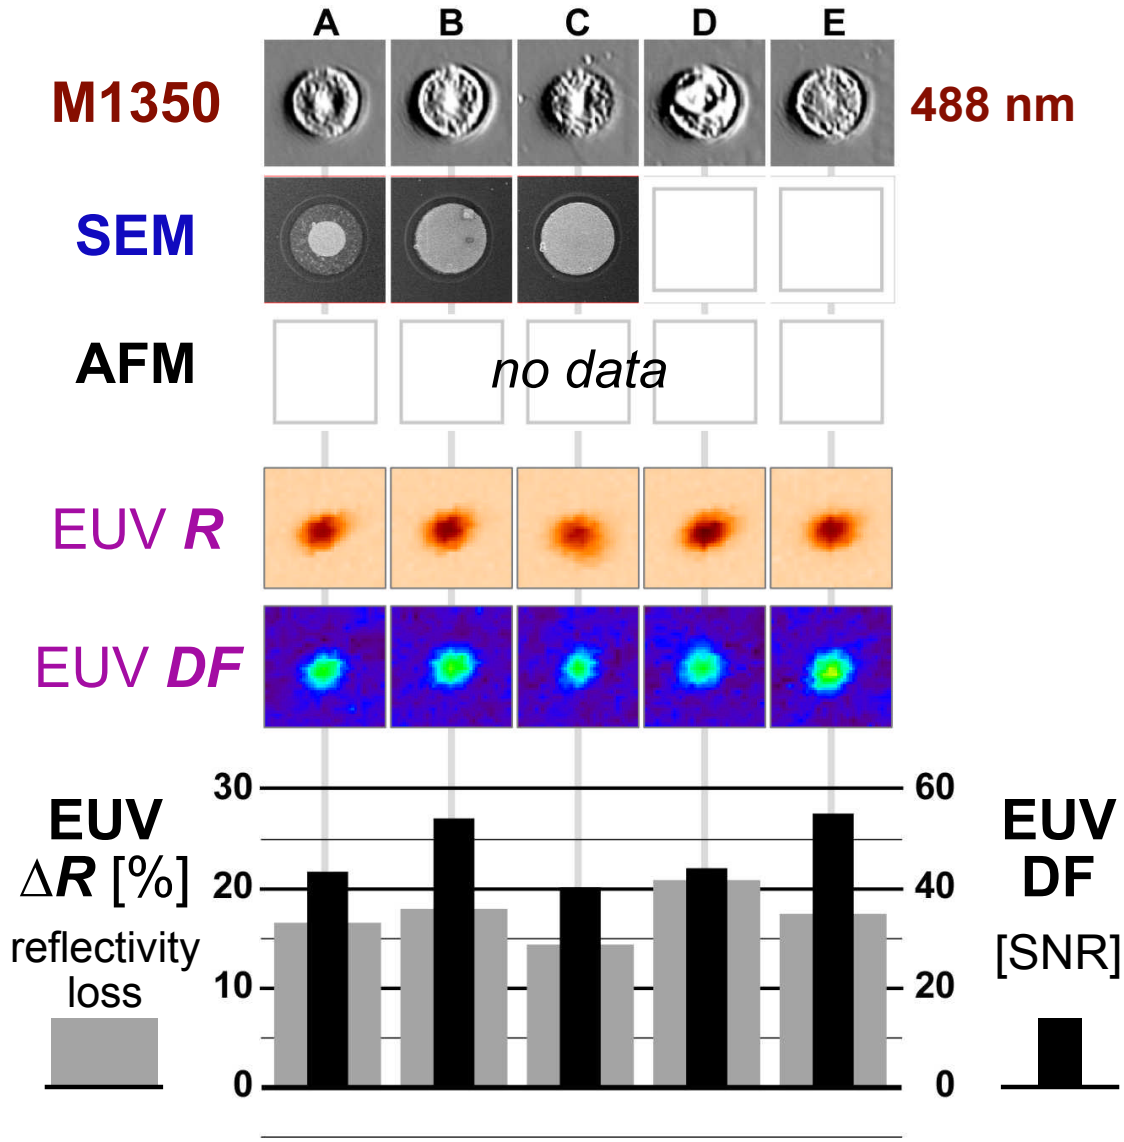

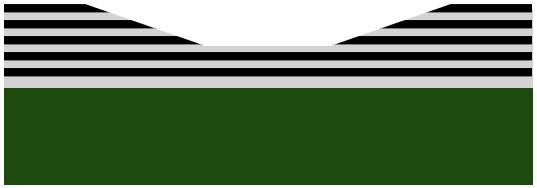

M1350:
→ High contrast

EUV:
→ Strong reflectivity loss
→ **Strong scattering**

sites dramatically
re-direct the beam

Measurements of Group II: *SiO_2 deposition*

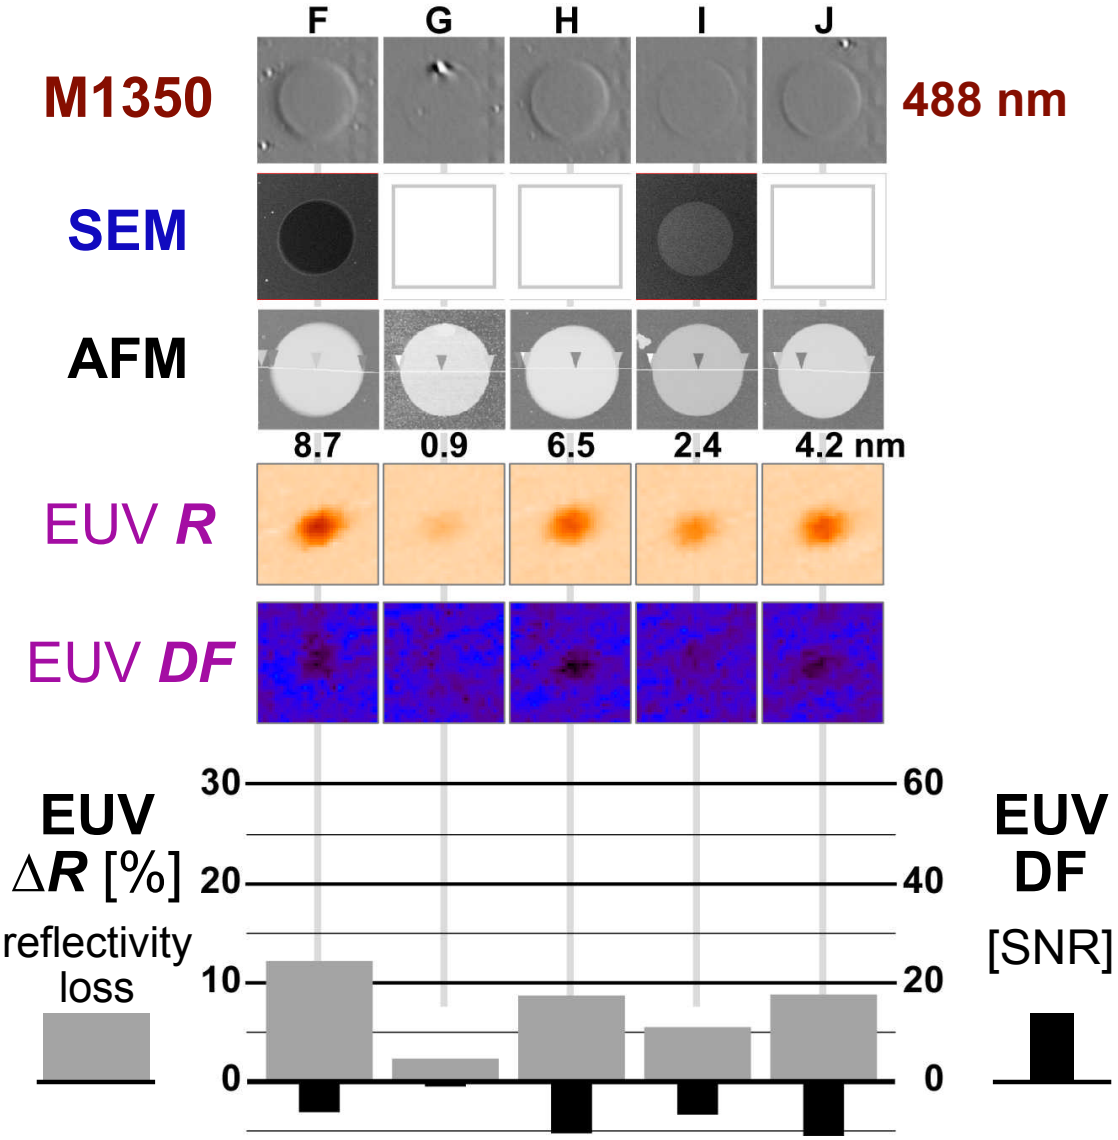

M1350:
→ Low contrast

EUV:
→ Moderate reflectivity loss
→ **Suppressed scattering**

Absorption eliminates scattered light. Reflectivity drops with SiO_2 thickness.

$\Delta R \approx -1\%$ for 2 nm SiO_2

KAGoldberg@lbl.gov

Measurements of Group III: *SiO_2 ditch protection*

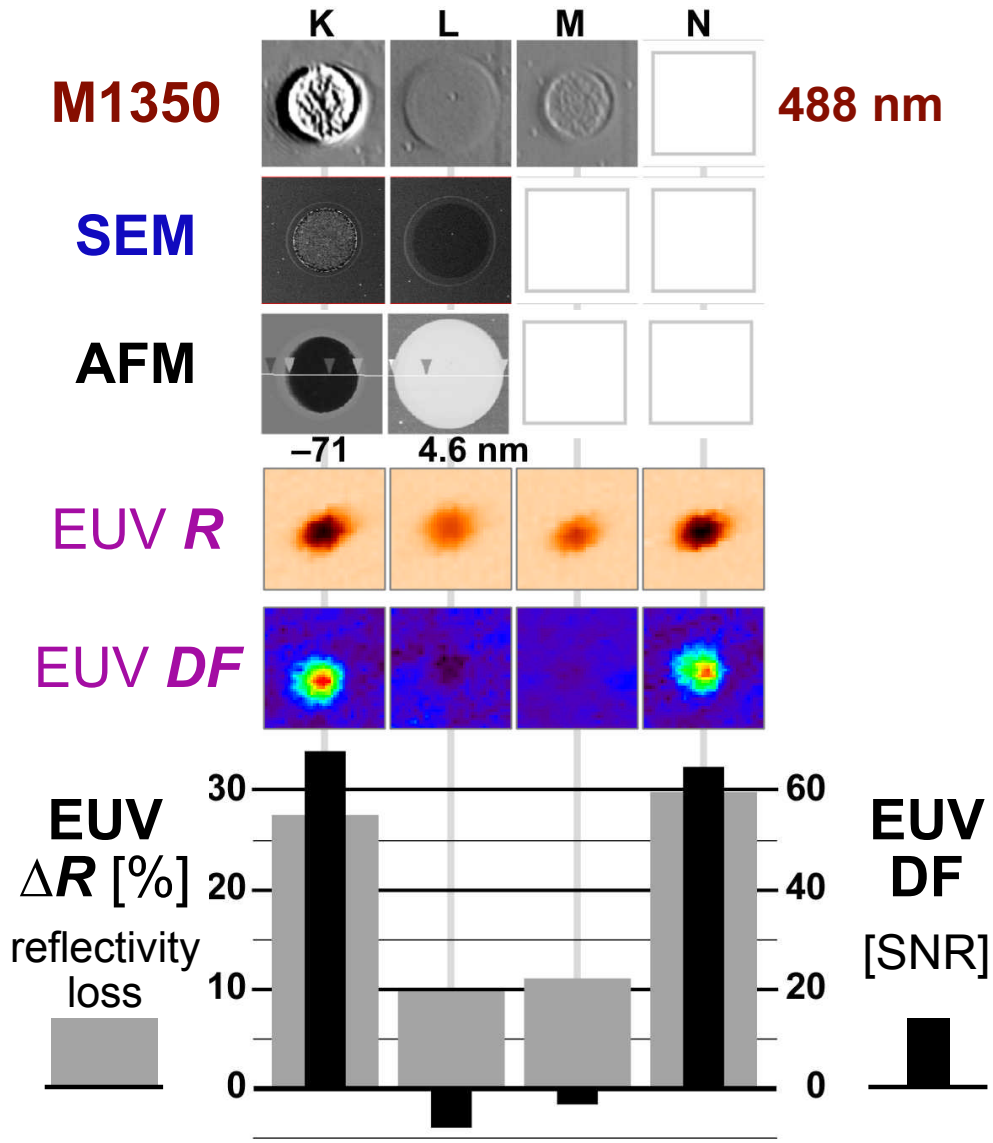

M1350:
→ Mixed results

EUV:
→ Mixed results

KAGoldberg@lbl.gov

Some sites scatter strongly, others absorb light

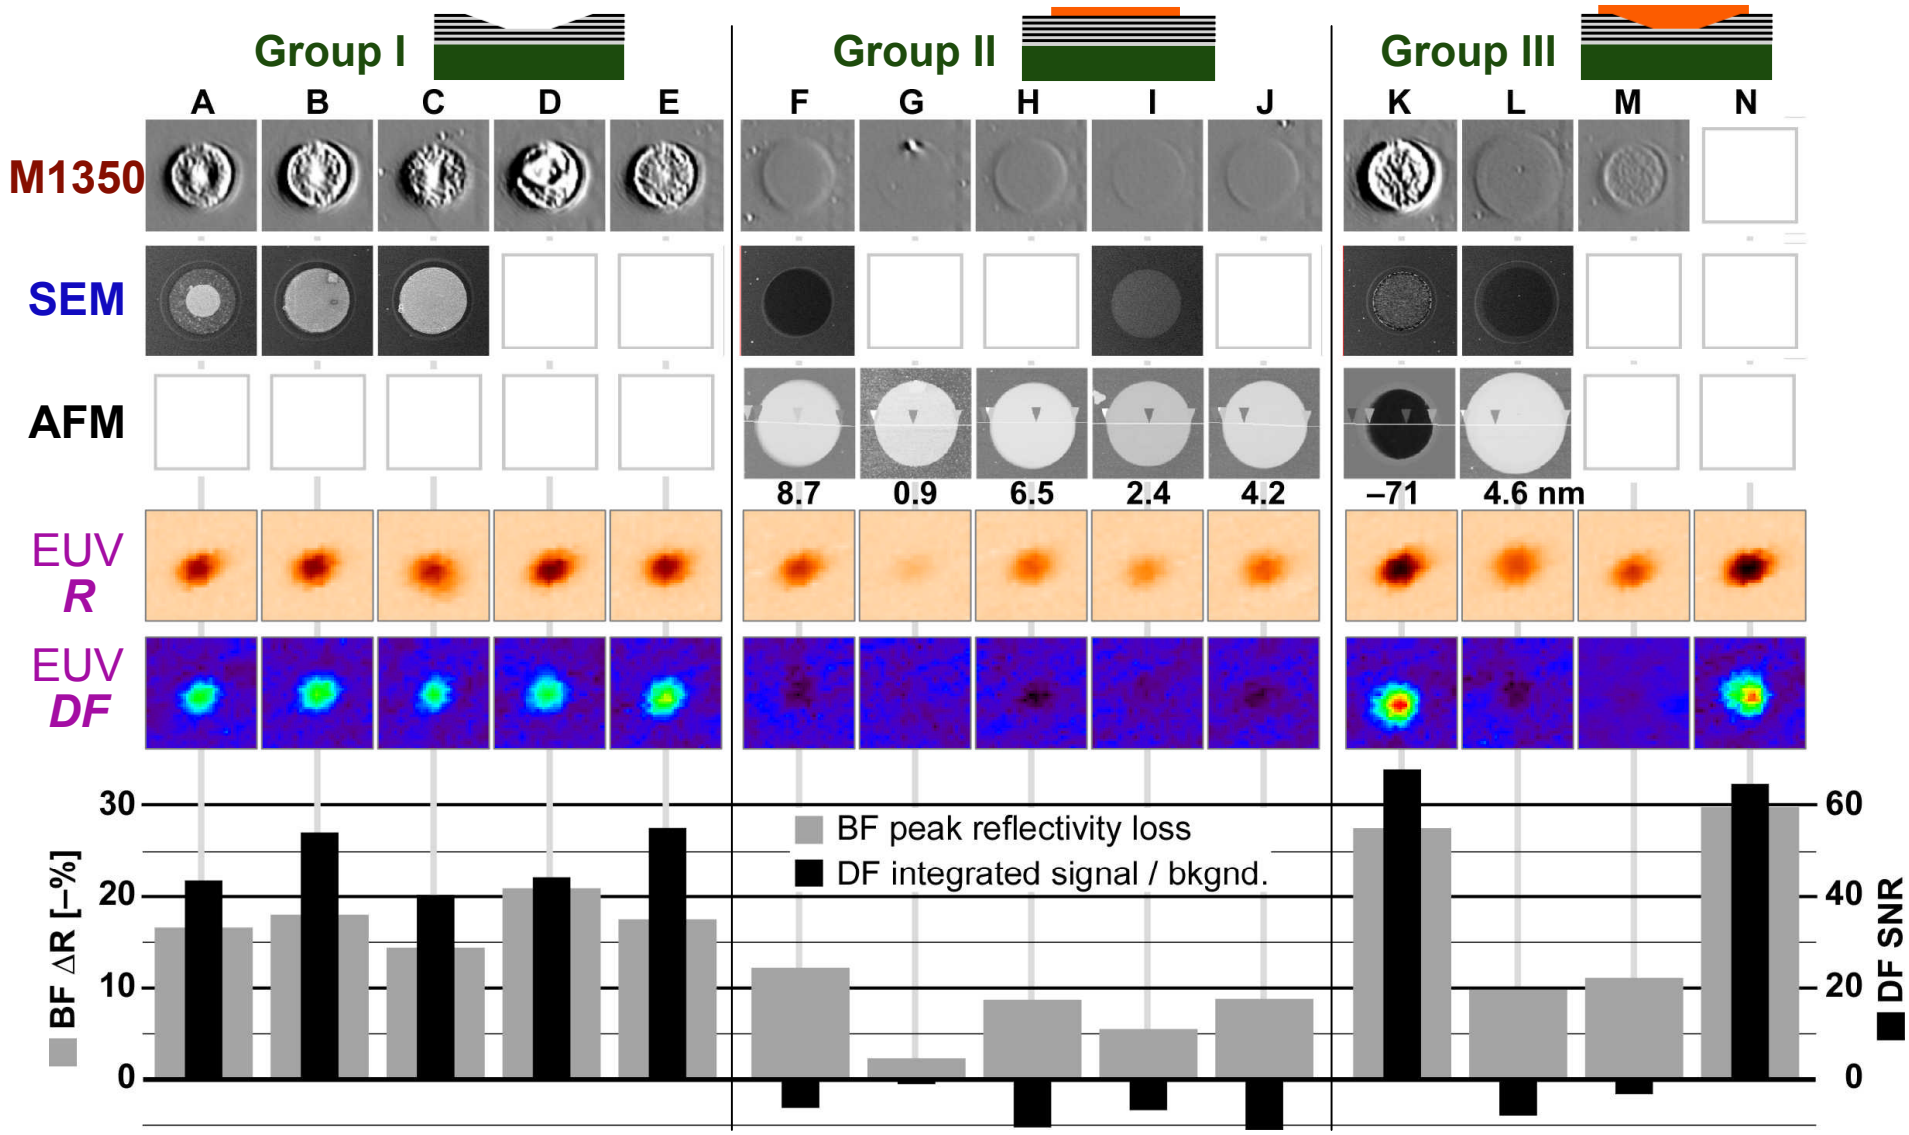

KAGoldberg@lbl.gov

Actinic BF and DF correlation has no single trend

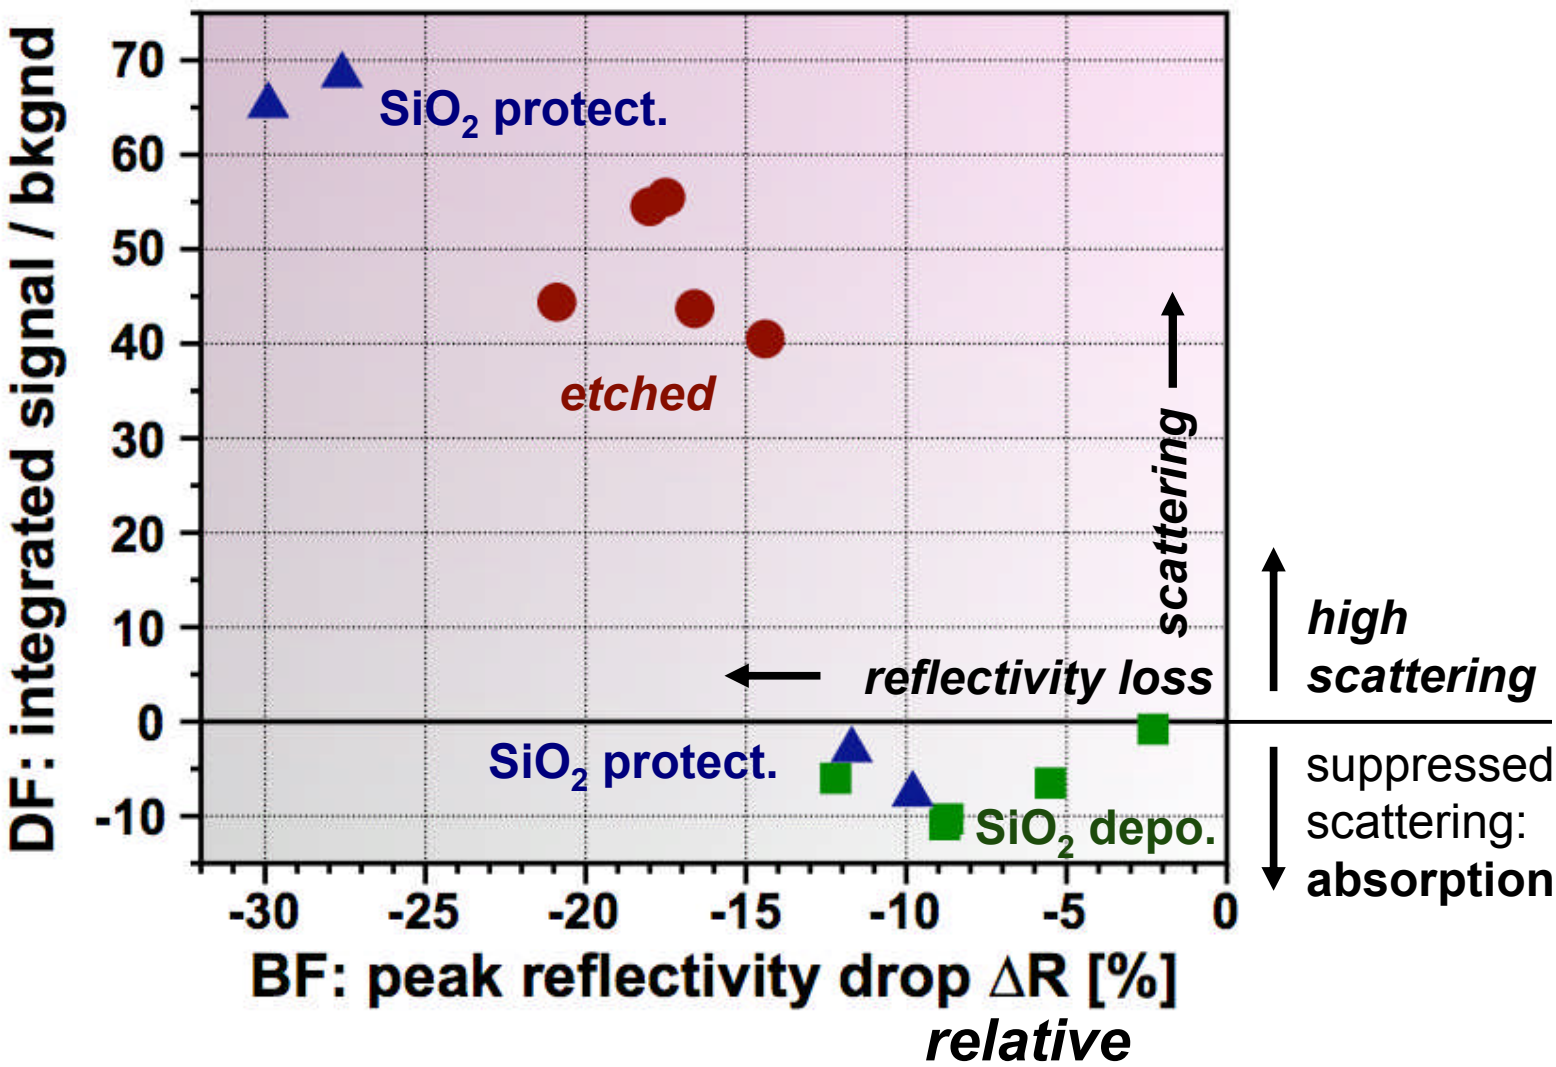

KAGoldberg@lbl.gov

These sites are well beyond the SEMI P-38-1103 reflection uniformity standard

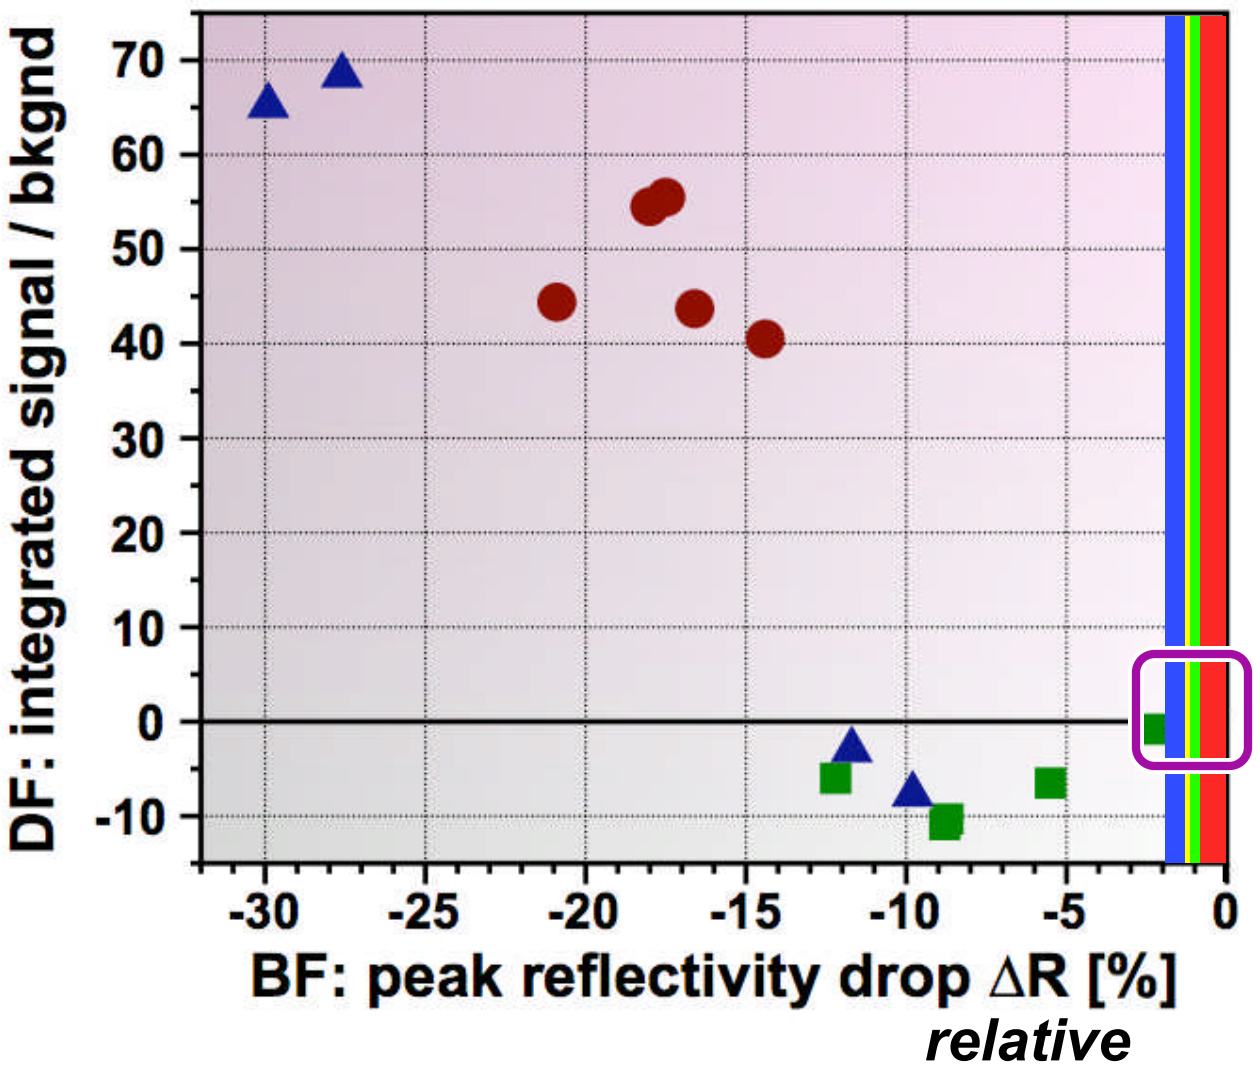

Allowed Δ***R*** **(abs)**

Class A: ≤ 0.5%

Class B: ≤ 0.7%

Class C: ≤ 0.8%

Class D: ≤ 1.2%

Perhaps the correlation here matters little since we are **so far beyond the allowed Δ*R***

Perhaps we should only consider *this* region

KAGoldberg@lbl.gov

Discussion

EUV light penetrates deeply into the resonant structure.
UV inspection probes the surface only: *depth* = 20–50 nm (3–8 bi-layers)

In *scanning-mode* the SEMATECH Berkeley actinic tool operates like **a 1-µm EUV reflectometer**.

We learn from measuring repair-test sites,
although an **ideal repair recipe** of this type was **<u>not found</u>**

Actinic inspection with **DF-only** or **BF-only** can miss critical defects!
- **DF has higher sensitivity** to small defects (due to flare, SNR, etc.)
- However, **DF may not see** µm-scale **absorptive** surface regions.

The SEMI P-38 standard may not adequately address reflectivity changes on the µm-to-mm length scale.

KAGoldberg@lbl.gov

Additional Topics

- Inspection damage
- Imaging pattern defects
- System upgrades in progress

KAGoldberg@lbl.gov

We measured reflectivity losses caused by *inspection damage*

High power inspection (all kinds) *can damage masks*

- A mask was prepared to **assess the damage threshold** of the Lasertec M7360, during qualification.
- **Actinic BF** saw narrow damage ($\Delta R_{rel} \leq -6\%$) at high power.
  – Some of the regions are ***undetectable*** in the Lasertec tool itself.
- Damaged areas may be **too small** for normal reflectometry.

Actinic BF scans of Lasertec inspection regions **intentionally damaged** with different operating modes and power levels.

calibration

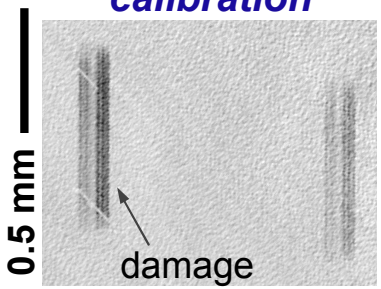

5 @ full power
ΔR_{max} = –5.4%

defect review

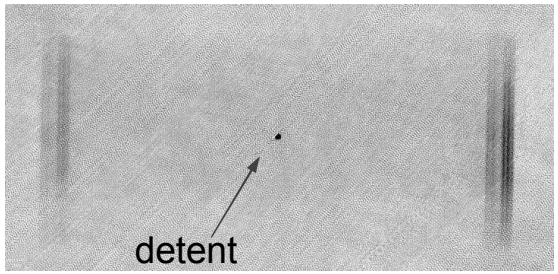

20 @ full power
ΔR_{max} = –2.1%

defect review

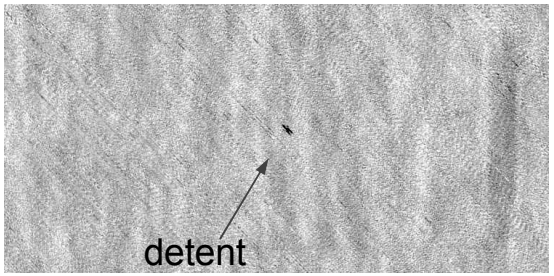

1 @ lower power
ΔR_{max} = –0.8%

KAGoldberg@lbl.gov

In collaboration with
Lasertec, **P. Kearney, H. Kusunose**

Early tests resolved elbow images down to 100-nm (mask), 25-nm (4x wafer equivalent)

- **System Resolution** is currently designed to match a 4×, 0.25-NA stepper.
- **Illumination:** 6° incidence. Partial coherence: $\sigma_x > 1.0$, $\sigma_y = 0.7$

Aerial Images

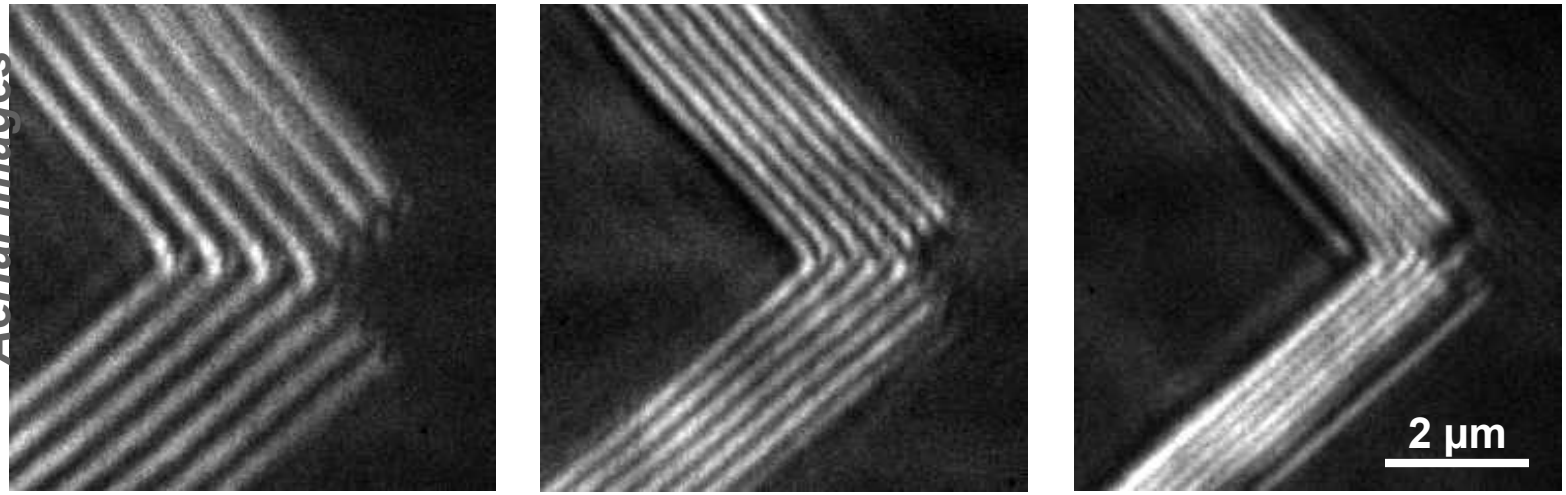

half-pitch: 250 nm **150 nm** **100 nm** (mask)
62.5 nm **37.5 nm** **25 nm** (4x wafer equiv.)

Imaging is performed with **EUV light, directly**

- There is **no scintillator**, **no conversion** to visible light, and **no microscope** objective.
- Consequently the measurements are **linear**.

KAGoldberg@lbl.gov

In collaboration with
T. Liang, *Intel*

Measuring the aerial image: size series, through focus, and repair sites

Size series: bright and dark defects

300 nm half-pitch (mask)
75 nm half-pitch (wafer)

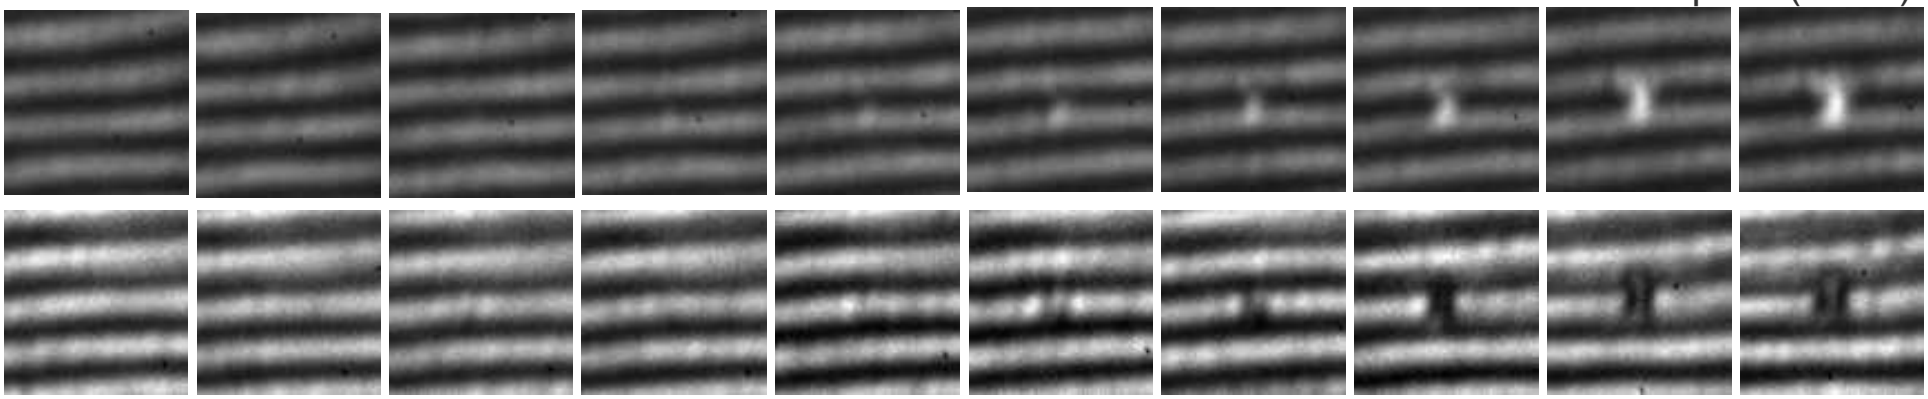

Through-focus series

2 µm

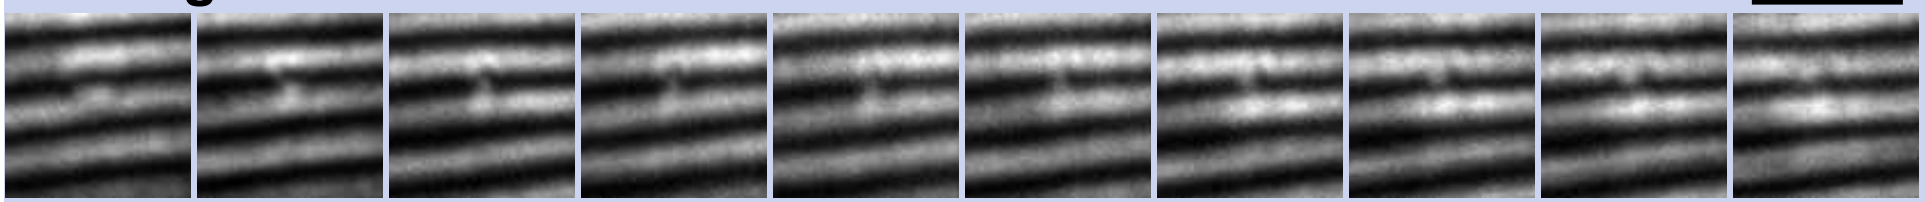

Defect repair studies

2 µm

half-pitch: 450 nm (mask)
112.5 nm (wafer)

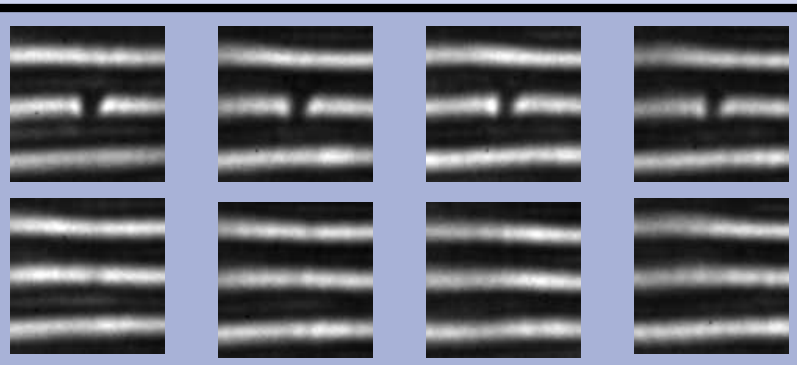

Complete series with ≥ 17 images were collected in **30-40 minutes.**

2007 SPIE 6517-11
KAGoldberg@lbl.gov

In collaboration with
C. Holfeld *AMTC*, B. LaFontaine *AMD*

AMD · ADVANCED MASK TECHNOLOGY CENTER · BERKELEY LAB · SEMATECH

Actinic tool performance upgrades: *in progress*

- New **vibration stabilizer**
- **Through-focus actuation** with ~50-nm height resolution
- Higher-quality **zoneplate lens** with features to help align the pupil
- **Ultra-flat turning mirror** to remove small-scale distortions in imaging
- **Incident-beam photo-diode** for absolute *R* calibration
- **Various alignment aids**

And special thanks to. . .

LBNL: Seno Rekawa, Drew Kemp, Ron Tackaberry, Su-Jane Lai

LLNL: John Taylor

Intel: Erdem Ultanir, Ted Liang Alan Stivers

Zeiss: Klaus Edinger

SEMATECH: Stefan Wurm, Kim Dean

KAGoldberg@lbl.gov